


## Radio, Stereo, and Compact Disc: Service and Repair

### AR82.60-P-7605V Remove/install Audio Components Center

- with CODE (525) MB Audio 50 APS radio

- with CODE (527) COMAND APS with single DVD drive (with navigation)

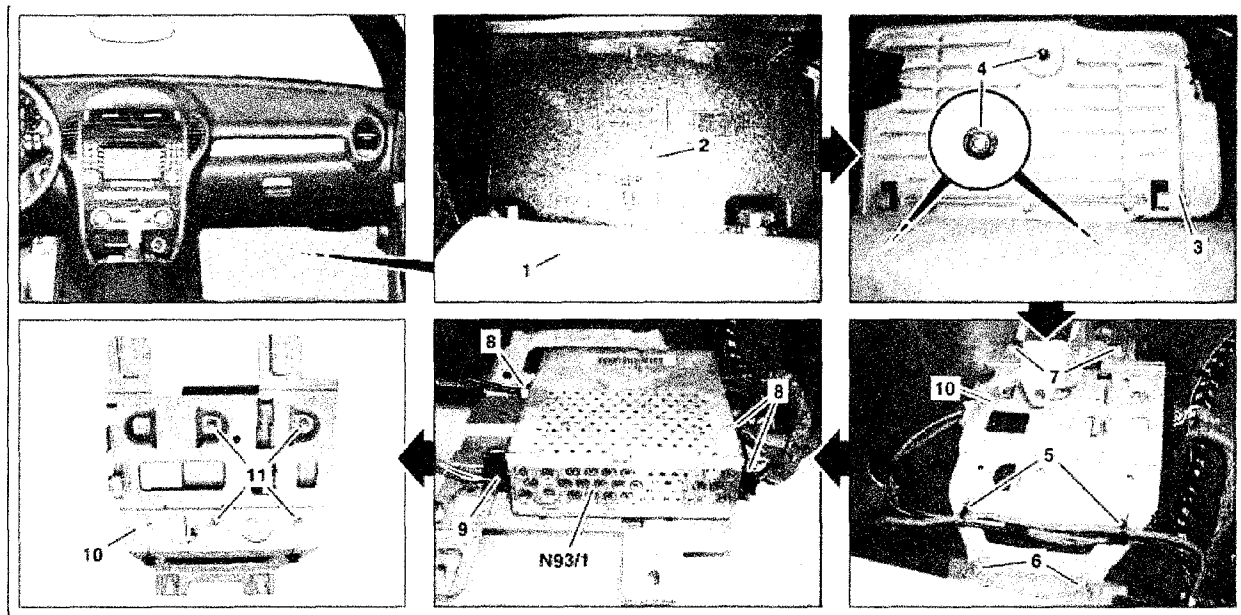

- 1 Floor mat
- 2 Impact damper
- 3 Step plate
- 4 Nuts
- 5 Tie strap

- 6 Nuts
- 7 Bolts
- 8 Electrical connectors
- 9 Fiber optical cable connection
- 10 Equipment carrier

- 11 Nuts
- N93/1 Audio gateway control unit

P82.60-4351-09

### Component Identification

e d	Removal/installation		
1.1	Put basic data of audio gateway control unit (N93/1) into intermediate storage in STAR DIAGNOSIS	When replacing audio gateway control unit (N93/1).  ↓ Installation: Transmit basic data from intermediate storage to new audio gateway control unit (N93/1).	
H	Connect STAR DIAGNOSIS, read out fault memory	STAR DIAGNOSIS diagnosis system	AD00.00-P-2000-04A *WE58.40-Z-1013-06A
2	Move front passenger seat to end position toward rear	↓ See Operating Instructions	
3	Disconnect battery ground line		AR54.10-P-0003V
4	Fold floor covering (1) towards rear at front passenger side		
5	Remove impact absorber (2) from step plate (3)	↓ Installation: Ensure that impact absorber (2) is correctly seated in clips of step plate (3).	
6	Undo nuts (4) and remove step plate (3) from front passenger side footwell		
7	Detach tie strap (5)	↓ Installation: Replace tie straps (5).	
8.1	Remove ETC [EGS] control unit from equipment carrier (10) and put aside with electrical connections attached	With TRANSMISSION 722.6	AR27.19-P-1719V
9	Unscrew nuts (6) and bolts (7)		
10	Turn equipment carrier (10) with audio gateway control unit (N93/1) over and disconnect electrical connections (8)		
11	Disconnect fiber optical cable connector (9)		
12	Cover up the fiber optical cable connector (9)		AR82.95-P-0005-01A
13	Remove audio gateway control unit (N93/1) with equipment carrier (10) from front passenger side footwell		
14.1	Unscrew nuts (11) and remove audio gateway control unit (N93/1) from equipment carrier (10)	Only when replacing audio gateway control unit (N93/1).	
15	Install in the reverse order		

### Steps 1.1 - 15

Workshop equipment/MB testers

WE58.40-Z-1013-06A	STAR DIAGNOSIS Compact diagnosis system for passenger cars, order number 6511 1801 00
--------------------	---