


[Select Vehicle](#) | [New TSBs](#) | [Technician's Reference](#)Component Search:  [Conversion Calculator](#)**1996 Volvo 850 GLT L5-2.4L VIN 55 B5254S**[Vehicle Level](#) → [Windows and Glass](#) → [Front Door Window Motor](#) → [Service and Repair](#) ←

Service and Repair

[Notes](#)

The procedure for replacing the power window winder motor is the same for both front and rear doors.

Removal :

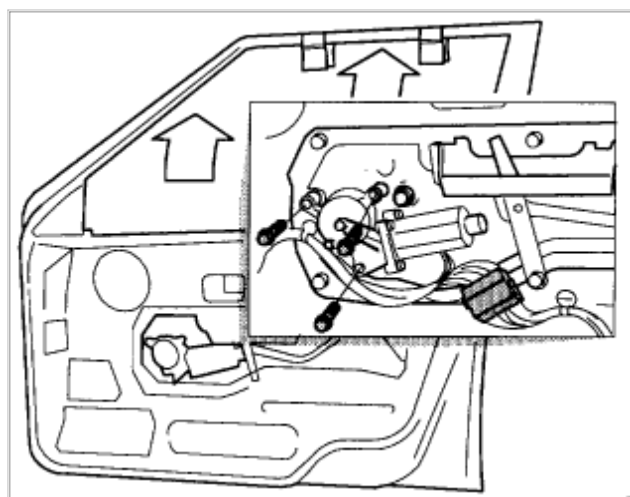

- Work with door open.
- Remove door panel.
- Wind window up as far as it will go.
- Fix window with tape, run tape over door [frame](#).
- Undo winder motor screws.
- Undo connector.

Installation :

- Connect connector to winder motor, fit it in place and put screws back in (torque setting **10 Nm/7.5 ft.lbf**).
- Remove tape holding window.
- Check that winder motor is working, wind window right down then right back up again.
- Reinstall door panel in reverse order.

© 2008 ALldata LLC. All rights reserved.
[Terms of Use](#)